

QUICK START GUIDE FOR DEMONSTRATION CIRCUIT 611

DUAL, SPREAD-SPECTRUM, LOW NOISE, INDUCTORLESS STEP DOWN DC/DC CONVERTER

LTC3252

DESCRIPTION

Demonstration circuit 611 is a dual, spread-spectrum, step down charge pump DC/DC converter featuring the LTC®3252EDE. It produces regulated 1.5V and 1.2V output voltages at up to 250mA of output current each from 2.7V to 5.5V input. The unique spread spectrum architecture of the LTC3252 provides highly efficient and low noise operation. The circuit has a low external parts count and requires only five small surface mount capacitors and four tiny surface mount resistors. DC611 demonstrates

appropriate layout techniques for the LTC3252 inductorless DC-DC converter. This power supply circuit is ideally suited for space-constrained battery-powered applications that require small size and low operating current.

**Design files for this circuit board are available.
Call the LTC factory.**

LTC is a registered trademark of Linear Technology Corporation.

QUICK START PROCEDURE

Demonstration circuit 611 is easy to set up and evaluate the performance of the LTC3252. Refer to Figure 1 for proper measurement equipment setup and follow the procedure below:

NOTE: When measuring the input or output voltage ripple, care must be taken to avoid a long ground lead on the oscilloscope probe. Measure the input or output voltage ripple by touching the probe tip directly across the V_{IN} , V_{OUT1} or V_{OUT2} and GND terminals. See Figure 2 for proper scope probe technique.

1. With power off, connect input power source to V_{IN} and GND terminals. Input voltage range is limited to between 2.7V and 5.5V for the 1.2V output and between 3.21V and 5.5V for the 1.5V output.
2. Place selector jumper JP1 in the ON position to enable V_{OUT1} (1.5V), and jumper JP2 in the ON position to enable V_{OUT2} .
3. If desired, loads may be connected from V_{OUT1} to GND and from V_{OUT2} to GND. The following V_{IN} (min) vs. load chart must be followed to ensure correct regulation of V_{OUT1} and V_{OUT2} :

Table 1. V_{IN} VS. LOAD CHART

V_{IN} (min) vs load		
V_{IN} (MIN)	I_{OUT1}	I_{OUT2}
3.5V	250mA	250mA
3.2V	100mA	250mA
3.1V	50mA	250mA
2.9V	---	250mA
2.7V	---	150mA

QUICK START GUIDE FOR DEMONSTRATION CIRCUIT 611

DUAL, SPREAD-SPECTRUM, LOW NOISE, INDUCTORLESS STEP DOWN DC/DC CONVERTER

NOTE: V_{OUT1} is in dropout for $V_{IN} < 3.0V$ and will cause the LTC3252 to operate in continuous mode instead of the more efficient burst mode. To monitor the actual performance of V_{OUT2} for $V_{IN} < 3.1V$, V_{OUT1} should be disabled by placing jumper JP1 in the OFF position.

4. Turn on the power at the input.

NOTE: Make sure that the input voltage does not exceed 5.5V.

5. Check for the proper output voltages. $V_{OUT1} = 1.5V$ and

$V_{OUT2} = 1.2V$. If there is no output, temporarily disconnect the load to make sure that the load is not set too high.

6. Once the proper output voltages are established, adjust the loads up to 250mA and observe the output voltage regulation, input and output ripple voltage, efficiency and other parameters. Remember to follow the V_{IN} (min) vs. load chart for correct regulation of V_{OUT1} and V_{OUT2} .

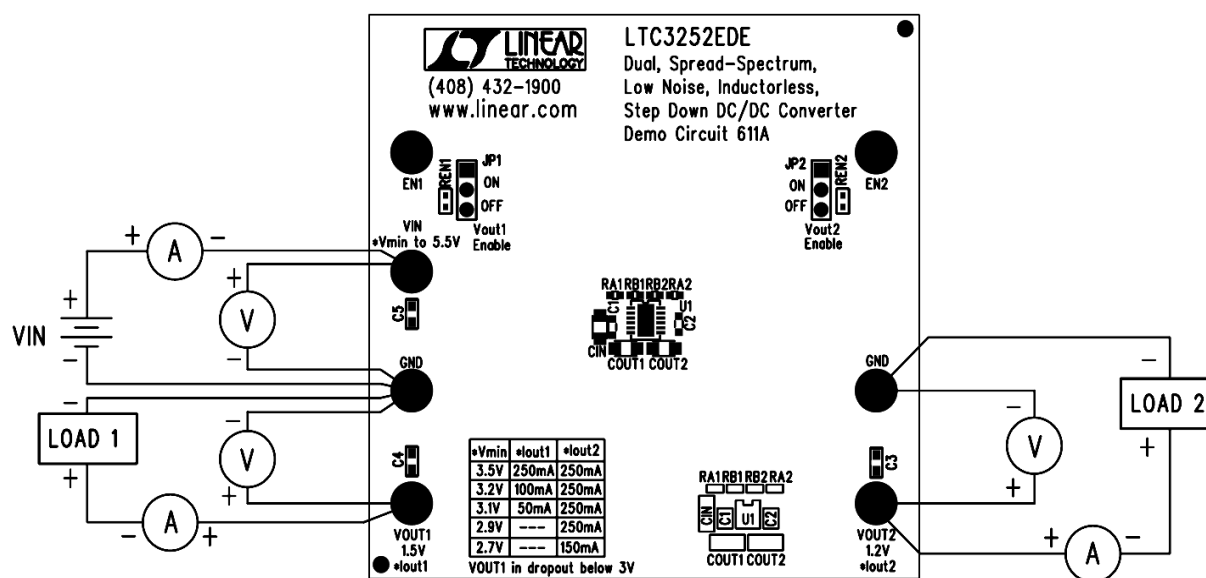


Figure 1. Proper Measurement Equipment Setup


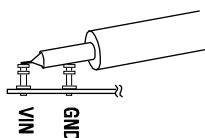


Figure 2. Scope Probe Placement for Measuring Input or Output Ripple

QUICK START GUIDE FOR DEMONSTRATION CIRCUIT 611

DUAL, SPREAD-SPECTRUM, LOW NOISE, INDUCTORLESS STEP DOWN DC/DC CONVERTER

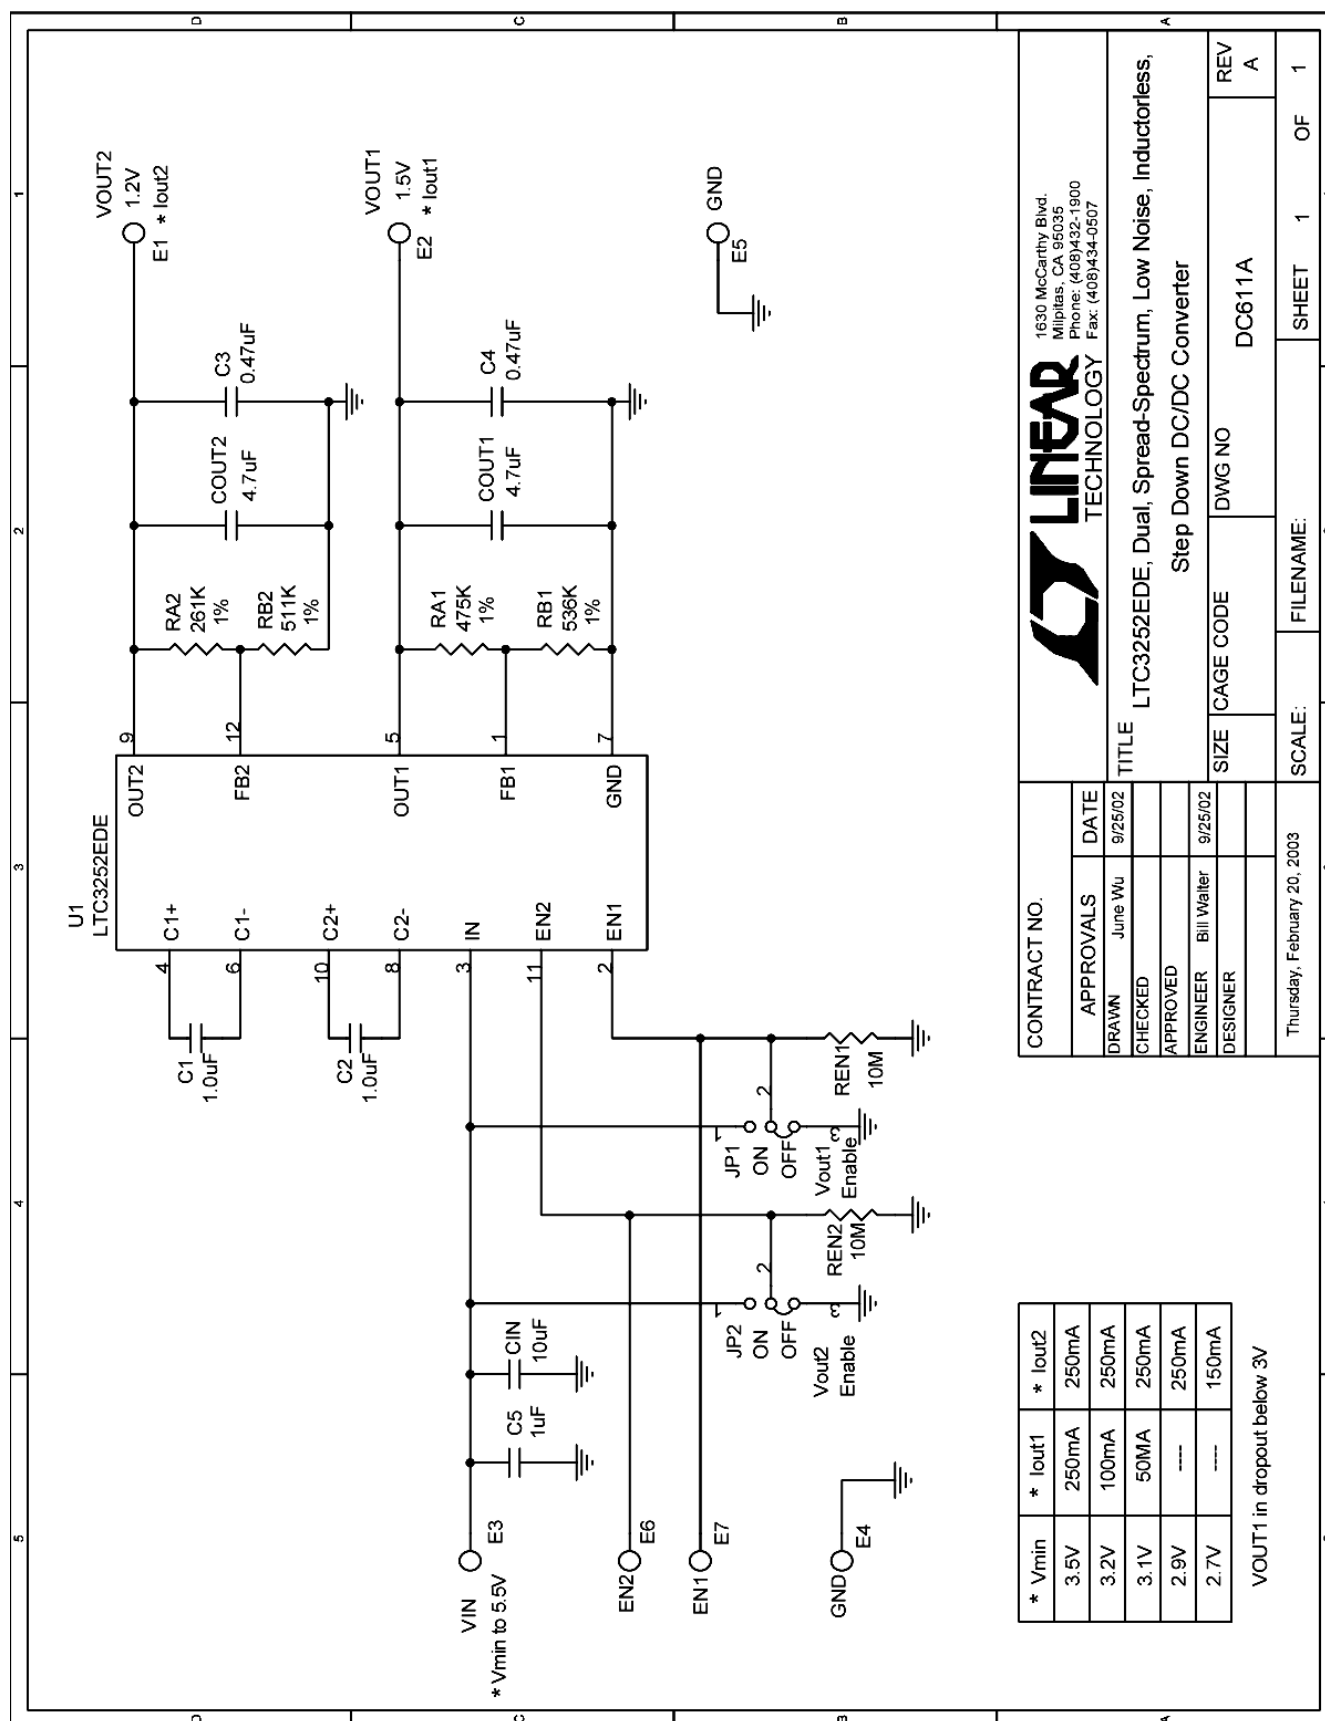

CONTRACT NO.		DATE		TITLE	
APPROVALS	June Wu	9/25/02		LTC3252EDE, Dual, Spread-Spectrum, Low Noise, Inductorless, Step Down DC/DC Converter	
CHECKED				SIZE	CAGE CODE
APPROVED				DWG NO	REV
ENGINEER	Bill Walter	9/25/02		DC611A	A
DESIGNER					
Thursday, February 20, 2003		SCALE:		FILENAME:	
				SHEET	1 OF 1

* Vmin	* Iout1	* Iout2
3.5V	250mA	250mA
3.2V	100mA	250mA
3.1V	50mA	250mA
2.9V	----	250mA
2.7V	----	150mA

VOUT1 in dropout below 3V



**Стандарт
Электрон
Связь**

Мы молодая и активно развивающаяся компания в области поставок электронных компонентов. Мы поставляем электронные компоненты отечественного и импортного производства напрямую от производителей и с крупнейших складов мира.

Благодаря сотрудничеству с мировыми поставщиками мы осуществляем комплексные и плановые поставки широчайшего спектра электронных компонентов.

Собственная эффективная логистика и склад в обеспечивает надежную поставку продукции в точно указанные сроки по всей России.

Мы осуществляем техническую поддержку нашим клиентам и предпродажную проверку качества продукции. На все поставляемые продукты мы предоставляем гарантию .

Осуществляем поставки продукции под контролем ВП МО РФ на предприятия военно-промышленного комплекса России , а также работаем в рамках 275 ФЗ с открытием отдельных счетов в уполномоченном банке. Система менеджмента качества компании соответствует требованиям ГОСТ ISO 9001.

Минимальные сроки поставки, гибкие цены, неограниченный ассортимент и индивидуальный подход к клиентам являются основой для выстраивания долгосрочного и эффективного сотрудничества с предприятиями радиоэлектронной промышленности, предприятиями ВПК и научно-исследовательскими институтами России.

С нами вы становитесь еще успешнее!

Наши контакты:

Телефон: +7 812 627 14 35

Электронная почта: sales@st-electron.ru

Адрес: 198099, Санкт-Петербург,
Промышленная ул, дом № 19, литера Н,
помещение 100-Н Офис 331