

Agilent U1270 Series Handheld Digital Multimeters

Be Ready for Winter Data Sheet

NEW

Features

- OLED display with 2000:1 contrast ratio and 160 degrees viewing angle^{3,4}
- 30,000-count resolution
- Measure up to 1000 V AC and DC
- Measure up to 10 A (20 A for 30 s)
- Resistance, diode test, temperature, capacitance
- Low Impedance mode^{2,3,4} and Low Pass Filter
- Peak detection of up to 250 μ s
- Continuity test with beeper and backlight^{1,2}
- Seven readings/s measurement rate for voltage and current
- Smooth function for accurately stable readings
- Up to 10,000 points internal memory for data logging
- *Bluetooth*® wireless connectivity with optional U1177A *Bluetooth*
- PC connectivity with optional U1173A IR-USB cable
- IP 54 certified – water and dust resistant
- CAT III 1000 V, CAT IV 600 V safety rating
- Up to 3000m operating altitude
- -40 to 55 °C operating temperature⁴

1. U1271A
2. U1272A
3. U1273A
4. U1273AX



Operational down to -40 °C temperature

The U1273AX OLED handheld digital multimeter, the latest addition to U1270 Series, is capable of operating in winter weather down to -40°C temperature. Even in frigid conditions, the U1273AX enables you to achieve immediate and accurate results without the need to warm up in advance.



OLED for more display clarity

Designed with OLED display, you can experience crystal-clear measurement readings with its outstanding 2000:1 contrast ratio. The display also allows wider viewing angles up to 160

degrees ensuring you get the right readings at the first glance even in poorly lit environments.



Increase productivity with *Bluetooth*® wireless connectivity

For wireless connectivity to smartphones and tablets, the U1270 Series is compatible with the U1177A infrared-to-*Bluetooth* adapter for maximum efficiency and productivity in completing measurements tasks. Adding the optional U1177A to a U1270 Series you can easily perform remote monitoring and data logging via Android devices or Windows®-based PC.



Key Functions

Water and dust resistance (IP54)

The series' tightly sealed design helps protect against water, dust and damage. Each handheld DMM is certified with IP 54 ratings so that you can carry out tests and measurements with confidence, even in harsh working conditions.

Operational up to 3000 meters altitude

For high altitude applications such as wind farm maintenance, you can measure with confidence using the U1270 Series, capable of measuring up to 3000 meters above sea level.

High measurement rate at seven readings per second for Voltage and Current

You can detect even the slightest change in your sensitive signals (Voltage and Current) with its high measurement rate capability. By clicking the resettable smooth function button, you may customize the readings' sensitivity suitable for various tests.

Visual alert for continuity test (for U1271A and U1272A only)

Continuity detection in noisy and dark environments is made easy with U1270 Series' loud beeper and flashing backlight that indicates continuity and thus improves safety.

Up to 10,000 recording points for manual, auto and event logging

Record measurements on-the-go and transfer data to PC conveniently with the huge internal memory of up to 10,000 recording points. The GUI Data Logging software and optional U1173A IR-USB cable are required to transfer data or perform real time data logging on a PC.

Built-in Low Pass Filter

The U1270 Series offers a 1 kHz LPF or Low Pass Filter to provide accurate Variable Frequency Drive (VFD) output measurements. This function eliminates high frequency noise and harmonics, ensuring motor filter efficiency.



Figure 1. Comparison of voltage output from industrial motor VFD without and with Low Pass Filter functionality.

Key Functions

Low impedance mode

Stray voltages are usually found in non-energized electrical wiring adjacent to powered wires due to capacitive or inductive coupling between these wires. The low impedance mode serves to eliminate false readings by dissipating these stray voltages thus improves safety and measurement efficiency during voltage measurement.

Peak detect at 250 μ s

The peak detect function allows you to capture the engine or motor startup transient as fast as 250 μ s.



Figure 2. U1272A helps you identify the presence of stray voltage on a disconnected wire running parallel with the wire powering up the VFD to an industrial motor. The image on the right shows the U1272A in low impedance mode.

Front and Back Panel Description



Front panel



1. U1272A, U1273A and U1273AX only

Once connected to any HH DMM via Bluetooth adapter you are able to log and view measurements graphically from smart phones and tablets.

Front and Back Panel Description



Choose Among These Four Models

	U1271A	U1272A	U1273A	U1273AX
Basic Features				
Display resolution	30,000 counts	30,000 counts	30,000 counts	30,000 counts
Display	LCD	LCD	OLED	OLED
Backlight	Yes	Yes	N/A	N/A
True RMS	AC	AC + DC	AC + DC	AC + DC
Measurements				
Voltage	Up to 1000 V AC, DC	Up to 1000 V AC, DC	Up to 1000 V AC, DC	Up to 1000 V AC, DC
Basic dcV accuracy	0.05% + 2 counts	0.05% + 2 counts	0.05% + 2 counts	0.05% + 2 counts
Current	Up to 10 A (20 A for 30 s)	Up to 10 A (20 A for 30 s)	Up to 10 A (20 A for 30 s)	Up to 10 A (20 A for 30 s)
Resistance	Up to 100 MΩ	Up to 300 MΩ	Up to 300 MΩ	Up to 300 MΩ
Other measurements	Frequency, capacitance, temperature, continuity, diode test	Frequency, capacitance, temperature, continuity, diode test	Frequency, capacitance, temperature, continuity, diode test	Frequency, capacitance, temperature, continuity, diode test
AC bandwidth	20 kHz	100 kHz	100 kHz	100 kHz
Low pass filter	Yes	Yes	Yes	Yes
Low impedance mode	—	Yes	Yes	Yes
Smart Ohm	—	Yes	Yes	Yes
Safety and Regulatory				
Over-voltage safety protection	CAT III 1000 V, CAT IV 600 V	CAT III 1000 V, CAT IV 600 V	CAT III 1000 V, CAT IV 600 V	CAT III 1000 V, CAT IV 600 V
General				
Logging memory	200 points	10,000 points	10,000 points	10,000 points
Connectivity	Optional IR-USB and <i>Bluetooth</i>	Optional IR-USB and <i>Bluetooth</i>	Optional IR-USB and <i>Bluetooth</i>	Optional IR-USB and <i>Bluetooth</i>
Operating temperature	–20 to 55 °C	–20 to 55 °C	–20 to 55 °C	–40 to 55 °C
Altitude	3000 meters	3000 meters	3000 meters	3000 meters
Water and dust ingress protection	IP 54	IP 54	IP 54	IP 54
Battery life	Up to 300 hours 4X AAA Alkaline	Up to 300 hours 4X AAA Alkaline	Up to 60 hours 4X AAA Alkaline	Up to 100 hours 4X AAA Lithium
Warranty	3 years	3 years	3 years	3 years

General Specifications

Display	<ul style="list-style-type: none"> • U1271A and U1272A: Liquid crystal display (LCD) (with maximum reading of 33,000 counts) • U1273A/U1273AX: Organic LED (OLED) display (with maximum reading of 33,000 counts)
Power consumption	<ul style="list-style-type: none"> • U1271A/U1272A: 460 mVA maximum (with backlight enabled) • U1273A/U1273AX: 180 mVA maximum (with maximum brightness)
Battery type	<ul style="list-style-type: none"> • 4 × 1.5 V Alkaline battery (ANSI/NEDA 24A or IEC LR03), or • 4 × 1.5 V Zinc Chloride battery (ANSI/NEDA 24D or IEC R03) • 4 × 1.5 V Lithium battery (ANSI/NEDA 24LF or IEC FR03)
Battery life	<ul style="list-style-type: none"> • U1271A and U1272A: 300 hours typical (based on new Alkaline batteries for DC voltage measurement) • U1273A/U1273AX: <ul style="list-style-type: none"> ◦ Based on new Alkaline batteries for DC voltage measurement: 30/45/60 hours typical at High/Medium/Low brightness, respectively ◦ Based on new Lithium batteries for DC voltage measurement: 50/100 hours typical at High/Low brightness, respectively • Low battery indicator will flash when the battery voltage drops: <ul style="list-style-type: none"> ◦ For non-rechargeable batteries: 4.4 V (approximately) ◦ For rechargeable batteries: 4.5 V (approximately)
Fuse	<ul style="list-style-type: none"> • 10 × 35 mm 440 mA/1000 V 30 kA fast-acting fuse • 10 × 38 mm 11 A/1000 V 30 kA fast-acting fuse
Operating environment	<ul style="list-style-type: none"> • Operating temperature: <ul style="list-style-type: none"> ◦ U1271A/ U1272A/U1273A: –20 to 55 °C, 0% to 80% RH ◦ U1273AX: –40 to 55 °C, 0% to 80% RH (using Lithium batteries) • Full accuracy up to 80% RH for temperatures up to 30 °C, decreasing linearly to 50% RH at 55 °C • Altitude up to 3000 meters • Pollution degree II
Storage compliance	–40 to 70 °C, 0 to 80% RH
Safety compliance	<ul style="list-style-type: none"> • CAN/CSA-C22.2 No. 61010-1-04 • EN/IEC 61010-1:2001 • ANSI/UL 61010-1:2004
Measurement category	CAT III 1000 V/CAT IV 600 V
Electromagnetic compatibility (EMC)	Commercial limits compliance with EN61326-1
Ingress protection rating	IP-54
Temperature coefficient	U1271A/U1272A/U1273A: 0.05 × (specified accuracy)/°C (from –20 to 18°C, or 28 to 55°C) U1273AX: 0.05 × (specified accuracy)/ °C (from –40 to 18°C, or 28 to 55°C)
Common Mode Rejection Ratio (CMRR)	> 120 dB at DC, 50/60 Hz ± 0.1% (1 kΩ unbalanced)
Normal Mode Rejection Ration (NMRR)	> 60 dB at 50/60 Hz ± 0.1%
Dimensions (W × H × D)	92 × 207 × 59 mm
Weight	<ul style="list-style-type: none"> • U1271A: 518 grams (with batteries) • U1272A: 520 grams (with batteries) • U1273A: 500 grams (with batteries) • U1273AX: 500 grams (with batteries)
Warranty	<ul style="list-style-type: none"> • Three years for product • Three months for product's accessories
Calibration cycle	One year

Specification Assumptions

- Accuracy is given as $\pm(\% \text{ of reading} + \text{counts of least significant digit})$ at $23\text{ }^{\circ}\text{C} \pm 5\text{ }^{\circ}\text{C}$, with relative humidity less than 80% RH.
- AC V and AC $\mu\text{A}/\text{mA}/\text{A}$ specifications are AC coupled, true RMS and are valid from 5% of range to 100% of range.
- The crest factor may be up to 3.0 at full scale except for the 1000 V range where it is 1.5 at full scale.
- For non-sinusoidal waveforms, add (2% reading + 2% full scale) typical, for crest factors up to 3.
- After Z_{LOW} voltage measurements, wait at least 20 minutes for thermal impact to cool before proceeding with any other measurement.

Electrical Specifications

DC specifications for U1271A, U1272A, U1273A and U1273AX

Function	Range	Resolution	Accuracy \pm (% of reading + counts of least significant digit)			Test current/ Burden voltage
			U1271A	U1272A	U1273A/U1273AX	
Voltage ¹	30 mV	0.001 mV	—	0.05 + 20	0.05 + 20	—
	300 mV	0.01 mV	0.05 + 5	0.05 + 5	0.05 + 5	—
	3 V	0.0001 V	0.05 + 5	0.05 + 5	0.05 + 5	—
	30 V	0.001 V	0.05 + 2	0.05 + 2	0.05 + 2	—
	300 V	0.01 V	0.05 + 2	0.05 + 2	0.05 + 2	—
	1000 V	0.1 V	0.05 + 2	0.05 + 2	0.05 + 2	—
	Z _{LOW} (low input impedance) enabled, applicable for 1000 V range and resolution only	0.1 V	—	1 + 20	1 + 20	—
Resistance ²	30 Ω	0.001 Ω	—	0.2 + 10	0.2 + 10	0.65 mA
	300 Ω	0.01 Ω	0.2 + 5	0.2 + 5	0.2 + 5	0.65 mA
	3 k Ω	0.0001 k Ω	0.2 + 5	0.2 + 5	0.2 + 5	65 μ A
	30 k Ω	0.001 k Ω	0.2 + 5	0.2 + 5	0.2 + 5	6.5 μ A
	300 k Ω	0.01 k Ω	0.2 + 5	0.2 + 5	0.2 + 5	0.65 μ A
	3 M Ω	0.0001 M Ω	0.6 + 5	0.6 + 5	0.6 + 5	93 nA/10 M Ω
	30 M Ω	0.001 M Ω	1.2 + 5	1.2 + 5	1.2 + 5	93 nA/10 M Ω
	100 M Ω	0.01 M Ω	2.0 + 10	—	—	93 nA/10 M Ω
	300 M Ω	0.01 M Ω	—	2.0 + 10 @ < 100 M Ω 8.0 + 10 @ > 100 M Ω	2.0 + 10 @ < 100 M Ω 8.0 + 10 @ > 100 M Ω	93 nA/10 M Ω
	300 nS	0.01 nS	1 + 10	1 + 10	1 + 10	93 nA/10 M Ω
Current ³	300 μ A	0.01 μ A	0.2 + 5	0.2 + 3	0.2 + 5	< 0.04 V/100 Ω
	3000 μ A	0.1 μ A	0.2 + 5	0.2 + 3	0.2 + 5	< 0.4 V/100 Ω
	30 mA	0.001 mA	0.2 + 5	0.2 + 3	0.2 + 5	< 0.08 V/1 Ω
	300 mA	0.01 mA	0.2 + 5	0.2 + 3	0.2 + 5	< 1.00 V/1 Ω
	3 A	0.0001 A	0.3 + 10	0.3 + 10	0.3 + 10	< 0.1 V/0.01 Ω
	10 A	0.001 A	0.3 + 10	0.3 + 10	0.3 + 10	< 0.3 V/0.01 Ω
Diode Test ⁴	3 V	0.0001 V	0.5 + 5	0.5 + 5	0.5 + 5	Approximately 1 to 2 mA
	Auto	0.0001 V	—	0.5 + 5	0.5 + 5	Approximately 0.1 to 0.3 mA

See notes on next page.

Electrical Specifications

Notes for DC specifications (previous page)

1. Notes for voltage specifications:

- The accuracy of the 30 to 300 mV range is specified after the Null function is used to subtract the thermal effect (by shorting the test leads).
- For Z_{LOW} measurements, autoranging is disabled and the multimeter's range is set to 1000 volts in the manual ranging mode.

2. Notes for resistance specifications:

- Overload protection: 1000 Vrms for short circuits with < 0.3 A current.
- Maximum open voltage is $< +3.3$ V.
- Built-in buzzer beeps when the resistance measured is less than $25 \Omega \pm 10 \Omega$. The multimeter can capture intermittent measurements longer than 1 ms.
- The accuracy of the 300 Ω to 3 k Ω range is specified after the Null function is used to subtract the test lead resistance and thermal effect (by shorting the test leads).
- U1273AX only: The accuracy for all resistance ranges is specified after the Null function is used when measuring at temperatures below -20 °C. The Null function is used to subtract the test lead resistance and thermal effect (by shorting the test leads).
- For the ranges of 30 M Ω and 100 M Ω , the RH is specified for $< 60\%$.
- The accuracy for ranges < 50 nS is specified after the Null function is used on an open test lead.
- The temperature coefficient of the 100 M Ω and 300 M Ω range is $0.1 \times (\text{specified accuracy})/^{\circ}\text{C}$ (from -40 to 18 °C or 28 to 55 °C).

3. Notes for current specifications:

- Overload protection for 300 μA to 300 mA range: 0.44 A/1000 V; 10×35 mm 30 kA fast-acting fuse.
- Overload protection for 3 A to 10 A range: 11 A/1000 V; 10×38 mm 30 kA fast-acting fuse.
- Specification for 300 mA range: 440 mA continuous.
- Specification for 10 A range: 10 A continuous. Add 0.3% to the specified accuracy when measuring signals > 10 to 20 A for 30 seconds maximum. After measuring currents > 10 A, cool down the multimeter for twice the duration of the measured time before proceeding with low current measurements.

4. Notes for diode specifications:

- Overload protection: 1000 Vrms for short circuits with < 0.3 A current.
- Built-in buzzer beeps continuously when the voltage measured is less than 50 mV and beeps once for forward-biased diode or semiconductor junctions measured between 0.3 V and 0.8 V ($0.3 \text{ V} \leq \text{reading} \leq 0.8 \text{ V}$).
- Open voltage for diode: $< +3.3$ V DC.
- Open voltage for Auto diode: $< +2.5$ V DC and > -1.0 V DC.

Electrical Specifications

AC specifications for U1271A

Function	Range	Resolution	Accuracy \pm (% of reading + counts of least significant digit)			
			45 Hz to 65 Hz	30 Hz to 1 kHz	1 kHz to 5 kHz	5 kHz to 20 kHz
True RMS AC Voltage ¹	300 mV	0.01 mV	0.7 + 20	1.0 + 25	2.0 + 25	2.0 + 40
	3 V	0.0001 V	0.7 + 20	1.0 + 25	2.0 + 25	2.0 + 40
	30 V	0.001 V	0.7 + 20	1.0 + 25	2.0 + 25	2.0 + 40
	300 V	0.01 V	0.7 + 20	1.0 + 25	2.0 + 25	—
	1000 V	0.1 V	0.7 + 20	1.0 + 25	—	—
	LPF (low pass filter) enabled, applicable for all voltage ranges and resolution		0.7 + 20	1.0 + 25 @ < 200 Hz 5.0 + 25 @ < 440 Hz	—	—

Function	Range	Resolution	Accuracy \pm (% of reading + counts of least significant digit)	Burden voltage/Shunt
			45 Hz to 2 kHz	
True RMS AC Current ²	300 μ A	0.01 μ A	0.9 + 25	< 0.04 V/100 Ω
	3000 μ A	0.1 μ A	0.9 + 25	< 0.4 V/100 Ω
	30 mA	0.001 mA	0.9 + 25	< 0.08 V/1 Ω
	300 mA	0.01 mA	0.9 + 25	< 1.00 V/1 Ω
	3 A	0.0001 A	1.0 + 25	< 0.1 V/0.01 Ω
	10 A	0.001 A	1.0 + 25	< 0.3 V/0.01 Ω

1. Notes for voltage specifications:

- Overload protection: 1000 Vrms. For millivolt measurements, 1000 Vrms for short circuits with < 0.3 A current.
- Input impedance: 10 M Ω (nominal) in parallel with < 100 pF.

2. Notes for current specifications:

- Overload protection for 300 μ A to 300 mA range: 0.44 A/1000 V; 10 \times 35 mm 30 kA fast-acting fuse.
- Overload protection for 3 A to 10 A range: 11 A/1000 V; 10 \times 38 mm 30 kA fast-acting fuse.
- Specification for 300 mA range: 440 mA continuous.
- Specification for 10 A range: 10 A continuous. Add 0.3% to the specified accuracy when measuring signals > 10 to 20 A for 30 seconds maximum. After measuring currents > 10 A, cool down the multimeter for twice the duration of the measured time before proceeding with low current measurements.

Electrical Specifications

AC specifications for U1272A/U1273A and U1273AX

Function	Range	Resolution	Accuracy \pm (% of reading + counts of least significant digit)				
			45 Hz to 65 Hz	20 Hz to 1 kHz	1 kHz to 5 kHz	5 kHz to 20 kHz	20 kHz to 100 kHz
True RMS AC Voltage ¹	30 mV	0.001 mV	0.6 + 20	0.7 + 25	1.0 + 25	1.0 + 40	3.5 + 40
	300 mV	0.01 mV	0.6 + 20	0.7 + 25	1.0 + 25	1.0 + 40	3.5 + 40
	3 V	0.0001 V	0.6 + 20	1.0 + 25	1.5 + 25	2.0 + 40	3.5 + 40
	30 V	0.001 V	0.6 + 20	1.0 + 25	1.5 + 25	2.0 + 40	3.5 + 40
	300 V	0.01 V	0.6 + 20	1.0 + 25	1.5 + 25	2.0 + 40	—
	1000 V	0.1 V	0.6 + 20	1.0 + 25	1.5 + 25	—	—
	LPF (low pass filter) enabled, applicable for all voltage ranges and resolution		0.6 + 20	1.0 + 25 @ < 200 Hz 5.0 + 25 @ < 440 Hz	—	—	—
	Z_{LOW} 1000 V		2.0 + 40	2 + 40 @ < 440 Hz	—	—	—

Function	Range	Resolution	Accuracy \pm (% of reading + counts of least significant digit)		Burden voltage/Shunt
			45 Hz to 65 Hz	20 Hz to 2 kHz	
True RMS AC Current ²	300 μ A	0.01 μ A	0.6 + 25	0.9 + 25	< 0.04 V/100 Ω
	3000 μ A	0.1 μ A	0.6 + 25	0.9 + 25	< 0.4 V/100 Ω
	30 mA	0.001 mA	0.6 + 25	0.9 + 25	< 0.08 V/1 Ω
	300 mA	0.01 mA	0.6 + 25	0.9 + 25	< 1.00 V/1 Ω
	3 A	0.0001 A	0.8 + 25	1.0 + 25	< 0.1 V/0.01 Ω
	10 A	0.001 A	0.8 + 25	1.0 + 25	< 0.3 V/0.01 Ω

1. Notes for voltage specifications:

- Overload protection: 1000 Vrms. For millivolt measurements, 1000 Vrms for short circuits with < 0.3 A current.
- Input impedance: 10 M Ω (nominal) in parallel with < 100 pF.
- Z_{LOW} impedance: 2 k Ω (nominal).
- The input signal is lower than the product of 20,000,000 V \times Hz.
- For 20 to 100 kHz accuracy: Three counts of the LSD per kHz of additional error is to be added for frequencies > 20 kHz and signal inputs < 10% of range.
- U1273AX only: For all AC voltage ranges, the accuracy is specified at 2.5% + 25 counts when measuring below -20°C for 20 to 45 Hz AC signals.

2. Notes for current specifications:

- Overload protection for 300 μ A to 300 mA range: 0.44 A/1000 V; 10 \times 35 mm 30 kA fast-acting fuse.
- Overload protection for 3 A to 10 A range: 11 A/1000 V; 10 \times 38 mm 30 kA fast-acting fuse.
- Specification for 300 mA range: 440 mA continuous.
- Specification for 10 A range: 10 A continuous. Add 0.3% to the specified accuracy when measuring signals > 10 to 20 A for 30 seconds maximum. After measuring currents > 10 A, cool down the multimeter for twice the duration of the measured time before proceeding with low current measurements.
- U1273AX only: The accuracy for the 300 μ A range, 3000 μ A range, and 30 mA is specified after the Null function is used when measuring at temperatures below -20°C . The Null function is used to subtract the test lead resistance and thermal effect (by shorting the test leads).
- U1273AX only: For all AC current ranges, the accuracy is specified at 2.5% + 25 counts when measuring below -20°C for 20 to 45 Hz AC signals.

Electrical Specifications

AC + DC specifications for U1272A/U1273A and U1273AX

Function	Range	Resolution	Accuracy \pm (% of reading + counts of least significant digit)				
			45 Hz to 65 Hz	20 Hz to 1 kHz	1 kHz to 5 kHz	5 kHz to 20 kHz	20 kHz to 100 kHz
True RMS AC + DC Voltage ¹	30 mV	0.001 mV	0.7 + 40	0.8 + 45	1.1 + 45	1.1 + 60	3.6 + 60
	300 mV	0.01 mV	0.7 + 25	0.8 + 30	1.1 + 30	1.1 + 45	3.6 + 45
	3 V	0.0001 V	0.7 + 25	1.1 + 30	1.6 + 30	2.1 + 45	3.6 + 45
	30 V	0.001 V	0.7 + 25	1.1 + 30	1.6 + 30	2.1 + 45	3.6 + 45
	300 V	0.01 V	0.7 + 25	1.1 + 30	1.6 + 30	2.1 + 45	—
	1000 V	0.1 V	0.7 + 25	1.1 + 30	1.6 + 30	—	—

Function	Range	Resolution	Accuracy \pm (% of reading + counts of least significant digit)		Burden voltage/Shunt
			45 Hz to 65 Hz	20 Hz to 2 kHz	
True RMS AC + DC Current ²	300 μ A	0.01 μ A	0.8 + 30	1.1 + 30	< 0.04 V/100 Ω
	3000 μ A	0.1 μ A	0.8 + 30	1.1 + 30	< 0.4 V/100 Ω
	30 mA	0.001 mA	0.8 + 30	1.1 + 30	< 0.08 V/1 Ω
	300 mA	0.01 mA	0.8 + 30	1.1 + 30	< 1.00 V/1 Ω
	3 A	0.0001 A	0.9 + 35	1.3 + 35	< 0.1 V/0.01 Ω
	10 A	0.001 A	0.9 + 35	1.3 + 35	< 0.3 V/0.01 Ω

1. Notes for voltage specifications:

- Overload protection: 1000 Vrms. For millivolt measurements, 1000 Vrms for short circuits with < 0.3 A current.
- Input impedance: 10 M Ω (nominal) in parallel with < 100 pF.
- For 20 to 100 kHz accuracy: Three counts of the LSD per kHz of additional error is to be added for frequencies > 20 kHz and signal inputs < 10% of range.
- U1273AX only: For all AC+DC voltage ranges, the accuracy is specified at 2.5% + 30 counts when measuring below –20 °C for 20 to 45 Hz AC+DC signals.

2. Notes for current specifications:

- Overload protection for 300 μ A to 300 mA range: 0.44 A/1000 V; 10 \times 35 mm 30 kA fast-acting fuse.
- Overload protection for 3 A to 10 A range: 11 A/1000 V; 10 \times 38 mm 30 kA fast-acting fuse.
- Specification for 300 mA range: 440 mA continuous.
- Specification for 10 A range: 10 A continuous. Add 0.3% to the specified accuracy when measuring signals > 10 to 20 A for 30 seconds maximum. After measuring currents > 10 A, cool down the multimeter for twice the duration of the measured time before proceeding with low current measurements.
- U1273AX only: The accuracy for the 300 μ A range, 3000 μ A range, and 30 mA is specified after the Null function is used when measuring at temperatures below –20 °C. The Null function is used to subtract the test lead resistance and thermal effect (by shorting the test leads).
- U1273AX only: For all AC+DC current ranges, the accuracy is specified at 2.5% + 30 counts when measuring below –20 °C for 20 to 45 Hz AC+DC signals.

Electrical Specifications

Temperature specifications^{1 - 6}

Thermocouple type	Range	Resolution	Accuracy \pm (% of reading + as specified below)		
			U1271A	U1272A	U1273A/U1273AX
K	–200 to 1372 °C	0.1 °C	1% of reading + 1 °C	1% of reading + 1 °C	1% of reading + 1 °C
	–328 to 2502 °F	0.1 °F	1% of reading + 1.8 °F	1% of reading + 1.8 °F	1% of reading + 1.8 °F
J	–210 to 1200 °C	0.1 °C	—	1% of reading + 1 °C	1% of reading + 1 °C
	–346 to 2192 °F	0.1 °F	—	1% of reading + 1.8 °F	1% of reading + 1.8 °F

1. The specifications above is specified after 60 minutes of warm-up time.
2. The accuracy does not include the tolerance of the thermocouple probe.
3. Do not allow the temperature sensor to contact a surface that is energized above 30 Vrms or 60 V DC. Such voltages pose a shock hazard.
4. Ensure that the ambient temperature is stable within ± 1 °C and that the Null function is used to reduce the test lead's thermal effect and temperature offset. Before using Null function, set the multimeter to measure temperature without ambient compensation (°C) and keep the thermocouple probe as close to the multimeter as possible (avoid contact with any surface that has a different temperature from the ambient temperature).
5. When measuring temperature with respect to any temperature calibrator, try to set both the calibrator and multimeter with an external reference (without internal ambient compensation). If both the calibrator and multimeter are set with internal reference (with internal ambient compensation), some deviations may show between the readings of the calibrator and multimeter, due to differences in ambient compensation between the calibrator and multimeter. Keeping the multimeter close to the output terminal of calibrator will help reduce the deviation.
6. The temperature calculation is specified according to the safety standards of EN/IEC-60548-1 and NIST175.

Capacitance specifications^{7, 8}

Range	Resolution	Accuracy \pm (% of reading + counts of least significant digit)		
		U1271A	U1272A	U1273A/U1273AX
10 nF	0.001 nF	1 + 5	1 + 5	1 + 5
100 nF	0.01 nF	1 + 2	1 + 2	1 + 2
1000 nF	0.1 nF	1 + 2	1 + 2	1 + 2
10 μ F	0.001 μ F	1 + 2	1 + 2	1 + 2
100 μ F	0.01 μ F	1 + 2	1 + 2	1 + 2
1000 μ F	0.1 μ F	1 + 2	1 + 2	1 + 2
10 mF	0.001 mF	1 + 2	1 + 2	1 + 2

7. Overload protection: 1000 Vrms for short circuits with < 0.3 A current.
8. The accuracy for all ranges is specified based on a film capacitor or better, and after the Null function is used to subtract the test lead resistance and thermal effect (by shorting the test leads).

Electrical Specifications

Frequency specifications^{1, 2}

Range	Resolution	Accuracy \pm (% of reading + counts of least significant digit)	Minimum input frequency
99.999 Hz	0.001 Hz	0.02 + 5	0.5 Hz
999.99 Hz	0.01 Hz	0.005 + 5	
9.9999 kHz	0.1 Hz	0.005 + 5	
99.999 kHz	1 Hz	0.005 + 5	
999.99 kHz	0.01 kHz	0.005 + 5	
> 1 MHz	0.1 kHz	0.005 + 5 @ < 1 MHz	

1. Overload protection: 1000 V; input signal is < 20,000,000 V \times Hz (product of voltage and frequency).
2. The frequency measurement is susceptible to error when measuring low-voltage, low-frequency signals. Shielding inputs from external noise pickup is critical for minimizing measurement errors. Turning on the low pass filter may help you to filter out the noise and achieve a stable reading.

Duty Cycle³

Mode	Range	Accuracy at full scale
DC coupling	99.99%	0.3 % per kHz + 0.3 %
AC coupling	99.99%	0.3 % per kHz + 0.3 %

3. Notes for duty cycle specifications:
 - The accuracy for duty cycle and pulse width measurements is based on a 3 V square wave input to the DC 3 V range. For AC couplings, the duty cycle range can be measured within the range of 10% to 90% for signal frequencies > 20 Hz.
 - The range of the duty cycle is determined by the frequency of the signal: $\{10 \mu\text{s} \times \text{frequency} \times 100\%\}$ to $\{[1 - (10 \mu\text{s} \times \text{frequency})] \times 100\%\}$.
 - The pulse width (positive or negative) must be > 10 μs . The range of the pulse width is determined by the frequency of the signal.

Pulse Width⁴

Range	Resolution	Accuracy at full scale
999.99 ms	0.01 ms	(duty cycle accuracy/frequency) + 0.01 ms
2000.0 ms	0.1 ms	(duty cycle accuracy/frequency) + 0.1 ms

4. Notes for pulse width specifications:
 - The accuracy for duty cycle and pulse width measurements is based on a 3 V square wave input to the DC 3 V range.
 - The pulse width (positive or negative) must be > 10 μs . The range of the pulse width is determined by the frequency of the signal.

Electrical Specifications

U1271A and U1272A frequency sensitivity for voltage measurements^{1, 2, 3}

Input range	Minimum sensitivity (RMS sine wave)			Trigger level for DC coupling	
	15 Hz to 100 kHz	0.5 Hz to 200 kHz	Up to 1 MHz	0.5 Hz to 200 kHz	
				U1271A	U1272A
30 mV	3 mV	3 mV	—	—	5 mV
300 mV	6 mV	8 mV	40 mV	10 mV	15 mV
3 V	0.12 V	0.2 V	0.4 V	0.15 V	0.15 V
30 V	0.6 V	0.8 V	2.6 V	1.5 V	1.5 V
300 V	6 V	8 V @ < 100 kHz	—	9 V @ < 100 kHz	9 V @ < 100 kHz
1000 V	50 V	50 V @ < 100 kHz	—	90 V @ < 100 kHz	90 V @ < 100 kHz

1. Maximum input for specified accuracy, refer to "AC specifications" on page 11.

2. 30 mV range applicable for U1272A only.

3. 200 kHz to 1 MHz range applicable for U1272A only.

U1273A/U1273AX sensitivity for voltage measurements⁴

Input range	Frequency sensitivity and trigger level			
	Minimum sensitivity (RMS sine wave)			Trigger level for DC coupling
Maximum input for specified accuracy, refer to AC voltage	15 Hz to 100 kHz	0.5 Hz to 200 kHz	Up to 1 MHz	0.5 Hz to 200 kHz
30 mV	3 mV	3 mV	—	5 mV
300 mV	7 mV	8 mV	38 mV	15 mV
3 V	0.12 V	0.12 V	0.48 V	0.15 V
30 V	0.8 V	0.8 V	3.5 V	1.5 V
300 V	6.7 V	8 V < 100 kHz	—	11 V < 100 kHz
1000 V	67 V	67 V < 100 kHz	—	110 V < 100 kHz

4. Maximum input for specified accuracy, refer to "AC specifications" on page 12.

Frequency sensitivity for current measurements⁵

Input range	Minimum sensitivity (RMS sine wave)	
	2 Hz to 30 kHz	
	U1271A/U1272A	U1273A/U1273AX
300 μ A	100 μ A	70 μ A
3000 μ A	70 μ A	120 μ A
30 mA	1.2 mA	1.2 mA
300 mA	12 mA	12 mA
3 A	0.12 A	0.12 A
10 A	1.2 A	1.2 A

5. Maximum input for specified accuracy, refer to "AC specifications" on page 11 and 12.

Electrical Specifications

Peak hold

Signal width	Accuracy for DC Voltage and Current
Single event >1 ms	Specified accuracy + 400
Repetitive >250 μ s	Specified accuracy + 1000

Decibel (dB) for U1272A and U1273A^{1, 2, 3}

dB base	Reference	Default reference
1 mW (dBm)	1 to 9999 Ω	50 Ω
1 V (dBV)	1 V	1 V

1. The reading of dBm is indicated in decibels of power above or below 1 mW, or decibels of voltage above or below 1 V. The formula is calculated according to the voltage measurement and specified reference impedance. Its accuracy is depended on the accuracy of the voltage measurement. See Decibel (dBV) accuracy table below.
2. Auto-ranging mode is used.
3. The bandwidth is according to voltage measurement.

Decibel (dBV) accuracy

Range	dBV range		Accuracy				
	Minimum	Maximum	45 Hz to 65 Hz	20 Hz to 1 kHz	1 Hz to 5 kHz	5 kHz to 20 kHz	20 Hz to 100 kHz
30 mV	-56.48	-30.46	0.06	0.07	0.09	0.1	0.32
300 mV	-36.48	-10.46	0.06	0.07	0.09	0.1	0.32
3 V	-16.48	+9.54	0.06	0.09	0.14	0.19	0.32
30 V	+3.52	+29.54	0.06	0.09	0.14	0.19	0.32
300 V	+23.52	+49.54	0.06	0.09	0.14	0.19	—
1000 V	+33.98	+60	0.06	0.09	0.14	—	—

Measurement rate (approximate)

Function	Times/second	
	U1271A	U1272A/U1273A/U1273AX
ACV	7	7
DCV	7	7
Ω	14	14
Ω with offset compensation	-	3
Diode	14	14
Auto Diode	-	3
Capacitance	4 (< 100 μ F)	4 (< 100 μ F)
DCA	7	7
ACA	7	7
Temperature	7	7
Frequency	2 (> 10 Hz)	2 (> 10 Hz)
Duty cycle	1 (> 10 Hz)	1 (> 10 Hz)
Pulse width	1 (> 10 Hz)	1 (> 10 Hz)

Ordering Information



U1271A

U1272A

U1273A

U1273AX

Standard shipped accessories

Standard test leads, test probes with 4-mm tips, K-type thermocouple and adapter, 4x AAA alkaline batteries (4x AAA lithium batteries for U1273AX only), Certificate of Calibration, UK 6 (test report), Quick Start Guide

Optional accessories

Measuring accessories (non-temperature)

U1161A

Extended test lead kit



Includes two test leads (red and black), two test probes, medium-sized alligator clips and 4-mm banana plugs.

- Test leads: CAT III 1000 V, CAT IV 600 V, 15 A
- Test probes (4-mm tips): CAT III 1000 V, CAT IV 600 V, 15 A
- Medium-sized alligator clips: CAT III 1000 V/CAT IV 600 V, 15 A
- 4-mm banana plugs: CAT II 600 V, 10 A

U1162A

Alligator clips



- One pair of insulated alligator clips (red and black). Recommended for use with Agilent standard test leads.
- CAT III 1000 V, CAT IV 600 V, 15 A

U1163A

SMT grabbers



- One pair of SMT grabbers (red and black). Recommended for use with Agilent standard test leads.
- Rated CAT II 300 V, 3 A

U1164A

Fine-tip test probes



- One pair of fine-tip test probes (red and black). Recommended for use with Agilent standard test leads.
- Rated CAT II 300 V, 3 A

U1168A

Standard test lead kit



Includes two test leads (red and black), 4-mm test probes, alligator clips, fine-tip test probes, SMT grabbers and mini grabber (black).

- Test leads: CAT III 1000 V, CAT IV 600 V, 15 A
- Test probe (19-mm tips): CAT II 1000 V, 15 A
- Test probe (4-mm tips): CAT III 1000 V, CAT IV 600 V, 15 A (highly recommended for CAT IV environment)
- Alligator clips: CAT III 1000 V, CAT IV 600 V, 15 A
- Fine-tip test probes: CAT II 300 V, 3 A
- SMT grabber: CAT II 300 V, 3 A
- Mini grabber: CAT II 300 V, 3 A

U1583B

AC current clamp



- Dual range: 40 A and 400 A
- Rated CAT III 600 V
- BNC-to-banana-plug adapter provided for use with DMMs
- -40 to 55 °C operating temperature

Ordering Information

Optional accessories

Measuring accessories (temperature)

U1180A
Thermocouple
adapter+lead kit,
J and K types



Includes thermocouple adapter, thermocouple bead J-type and thermocouple bead K-type.

- T/C adapter J/K-type
- T/C bead J-type: -20 to 200 °C
- T/C bead K-type: -20 to 200 °C

U1181A
Immersion
temperature probe



- Type-K T/C for use in oil and other liquids
- Measurement range: -50 to 700 °C
- Includes adapter U1184A for connection to DMM

U1182A
Industrial surface
temperature probe



- Type-K T/C for use on still surfaces
- Measurement range: -50 to 400 °C
- Includes adapter U1184A for connection to DMM

U1183A
Air temperature
probe



- Type-K T/C for use in air and non-caustic gas
- Measurement range: -50 to 800 °C
- Includes adapter U1184A for connection to DMM

U1184A
Temperature probe
adapter



- Mini-connector-to-banana-plug adapter for use with DMM

U1185A
J-type thermocouple
and adapter



- T/C adapter J/K-type
- T/C bead J-type: -20 to 200 °C

U1186A
K-type
thermocouple and
adapter



- T/C adapter J/K-type
- T/C bead J-type: -20 to 200 °C

Ordering Information

Optional accessories

U1171A

Magnetic hanging
kit



For fastening the DMM to a steel surface so both hands are free

U1173A

IR-to-USB cable



- For remote control and data logging to PC
- Maximum baud rate: 19,200 bits per second

U1174A

Soft carrying case



The convenient way to carry your DMM and essential accessories

- Dimension: 9 inches (H) x 5 inches (W) x 3 inches (D)

U1177A

Bluetooth Adapter



- Enables *Bluetooth* connection to Agilent handheld digital multimeters
- Support the U1230, U1240, U1250 and U1270 Series handheld multimeters
- Remote monitoring and data logging capabilities via Android devices or Windows-based PC
- Recommended to use Lithium battery in lower than -20°C in temperature for long hours of operation



Agilent Email Updates

www.agilent.com/find/emailupdates

Get the latest information on the products and applications you select.



www.axistandard.org

AdvancedTCA® Extensions for Instrumentation and Test (AXIe) is an open standard that extends the AdvancedTCA for general purpose and semiconductor test. Agilent is a founding member of the AXIe consortium.



www.lxistandard.org

LAN eXtensions for Instruments puts the power of Ethernet and the Web inside your test systems. Agilent is a founding member of the LXI consortium.



www.pxisa.org

PCI eXtensions for Instrumentation (PXI) modular instrumentation delivers a rugged, PC-based high-performance measurement and automation system.

Agilent Channel Partners

www.agilent.com/find/channelpartners

Get the best of both worlds: Agilent's measurement expertise and product breadth, combined with channel partner convenience.

Bluetooth and the Bluetooth logos are trademarks owned by Bluetooth SIG, Inc., U.S.A. and licensed to Agilent Technologies, Inc.

Windows, Windows NT, MS Windows, and Windows Vista are trademarks or registered trademarks of Microsoft Corporation in the United States and/or other countries.



Agilent Advantage Services is committed to your success throughout your equipment's lifetime. To keep you competitive, we continually invest in tools and processes that speed up calibration and repair and reduce your cost of ownership. You can also use Infoline Web Services to manage equipment and services more effectively. By sharing our measurement and service expertise, we help you create the products that change our world.

www.agilent.com/find/advantageservices



www.agilent.com

www.agilent.com/find/handheldmm

For more information on Agilent Technologies' products, applications or services, please contact your local Agilent office. The complete list is available at:

www.agilent.com/find/contactus

Americas

Canada	(877) 894 4414
Brazil	(11) 4197 3600
Mexico	01800 5064 800
United States	(800) 829 4444

Asia Pacific

Australia	1 800 629 485
China	800 810 0189
Hong Kong	800 938 693
India	1 800 112 929
Japan	0120 (421) 345
Korea	080 769 0800
Malaysia	1 800 888 848
Singapore	1 800 375 8100
Taiwan	0800 047 866
Other AP Countries	(65) 375 8100

Europe & Middle East

Belgium	32 (0) 2 404 93 40
Denmark	45 45 80 12 15
Finland	358 (0) 10 855 2100
France	0825 010 700*
*0.125 €/minute	
Germany	49 (0) 7031 464 6333
Ireland	1890 924 204
Israel	972-3-9288-504/544
Italy	39 02 92 60 8484
Netherlands	31 (0) 20 547 2111
Spain	34 (91) 631 3300
Sweden	0200-88 22 55
United Kingdom	44 (0) 118 927 6201

For other unlisted countries:

www.agilent.com/find/contactus

Revised: January 6, 2012

Product specifications and descriptions in this document subject to change without notice.

© Agilent Technologies, Inc. 2012
Published in USA, August 29, 2012
5990-6425EN



Agilent Technologies

Agilent U1177A IR-to-Bluetooth Adapter

Data Sheet

Features

- Enables Bluetooth® connection to Agilent handheld digital multimeters
- Easy to install by attaching to Infrared (IR) port located at the back of Agilent handheld digital multimeters
- Compatible with Agilent U1230 series, U1240 series, U1250 series and U1270 series handheld digital multimeters
- Operated by two 1.5 V AAA batteries

The Bluetooth® word mark and logos are registered trademark owned by Bluetooth SIG, Inc and any use of such marks by Agilent Technologies, Inc. is under license. Other trademark and trade names are those of their respective owners.

Agilent U1177A Infrared (IR)-to-Bluetooth® adapter offers wireless remote connectivity solution via Bluetooth® connection simply by attaching the adapter to the IR port of an Agilent handheld digital multimeter. The wireless remote connectivity is set up when an Agilent handheld digital multimeter is connected to U1177A and an Android device (tablet or smart phone) with the installed software. Every U1177A also has a unique Media Access Control (MAC) address. User can quickly and easily scan for the right U1177A using their Android device and pair up with the U1177A.

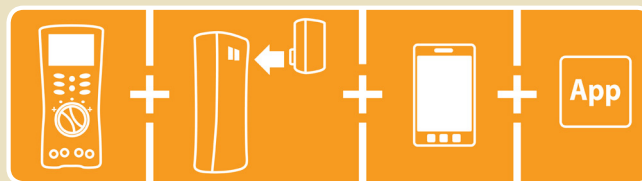


Figure 1. Agilent wireless remote connectivity solution





Take a closer look

Low battery indication:
Red LED flashing

Bluetooth® disconnected:
Green LED flashing

Bluetooth® connected:
Green solid LED

Bluetooth® power off:
LED off

ON/OFF/Setup
slide switch

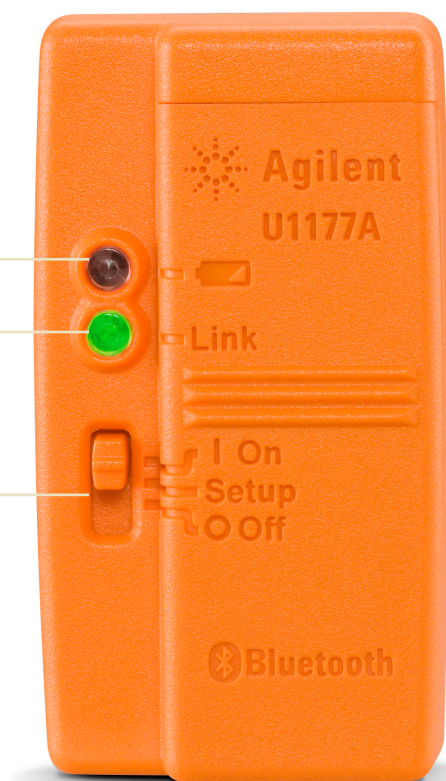


Figure 2. The U1177A as illustrated

Perform data logging with multimeters – wirelessly!



Figure 3. Data logging with Agilent Mobile Logger software.

Data logging is an important function for industrial users to capture data streams or plotting trending graphs. These data and graphs are used for analysis to identify intermittent behavior or detect drifts. Agilent Mobile Logger is the free Android application software that logs data and provides trending graphs from Agilent handheld digital multimeters. Agilent Mobile Logger offers an array of extended functions such as sending e-mail or Short Message Service (SMS) automatically, and pan and zoom function via the Android device's touch screen. Alternatively, data logging and monitoring activities can also be performed at the comfort of one's Personal Computer (PC) via a downloadable Agilent GUI data logger software.

Notes:

1. Agilent Mobile Meter and Agilent Mobile Logger can be downloaded from www.agilent.com/find/hh-Android or from Android Market (<https://market.android.com/>)
2. Agilent GUI Data Logger Software can be www.agilent.com/find/hh-logger

Perform up to three multimeter measurements at the same time with Agilent Mobile Meter

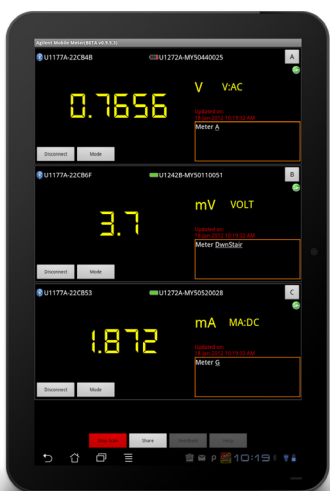


Figure 4. Up to three multimeters measurements with the Agilent Mobile Meter

Agilent Mobile Meter is a free Android application software that allows an Android device to connect, control and perform up to 3 multimeter measurements. Without the need to be physically present at various points, users can now extend their reach to two or three places. This solution allows you to make measurements from a safe distance, eliminates the need to walk back-and-forth between measure target and control points, and monitors multiple measurements simultaneously. Achieve higher work productivity when you use the U1177A with your Agilent handheld digital multimeters.

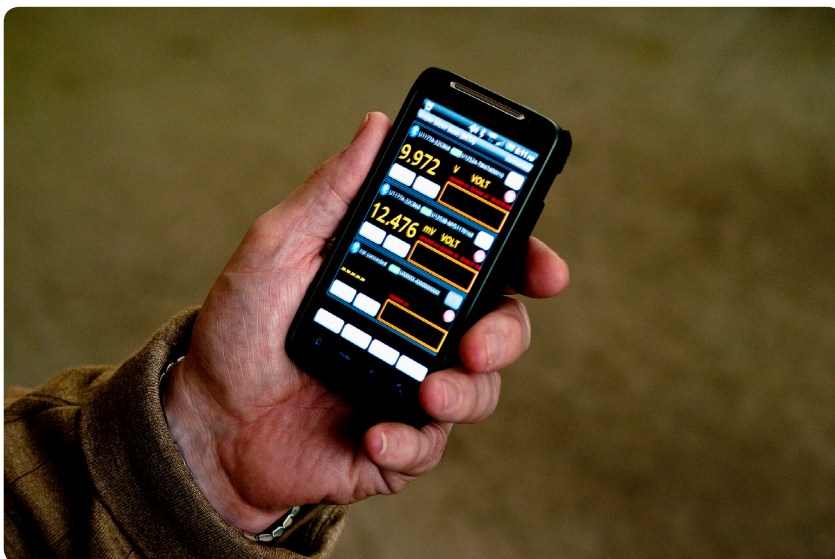


Figure 5. Make measurements with the Agilent Mobile Meter via an Android smart phone

Specifications

Product characteristics	Description
Radio specification	<ul style="list-style-type: none"> • Frequency: 2402 MHz ~ 2480 MHz • Antenna Power: 1 mW or less • Number of Channels: 79 • Modulation: GFSK / PSK
Operating environment	Operating temperature from –20 to 55 °C
Storage environment	Storage temperature from –40 to 70 °C
Relative humidity (R.H.)	Relative humidity up to 95% at 40 °C (non-condensing)
Power consumption	Maximum 130 mVA for two 1.5 V AAA batteries
Battery life	30 hours typical (based on continuous data transfer)
Battery type	Alkaline 24 A (ANSI/NEDA) and LR03 (IEC), or Zinc Chloride 24 D (ANSI/NEDA) and R03 (IEC)
Dimension (W x H x L)	39.0 × 71.0 × 37.0 mm
Weight	60 g with batteries
Warranty	Three months
Bluetooth	"Bluetooth" Version 2.1 + EDR compliant, SPP profile, Class 2 device (with 10 metres connection range)
Safety	<p>The U1177A complies with the requirements of the following safety and regulation standards:</p> <ul style="list-style-type: none"> • FCC Part15C (Certification) (15.209, 15.247) FCC ID: ZKMAGILENT-U1177A • FCC Part15B (DoC) (15.109) • RSS–210 Issue 8:2010 IC: 6310A–U1177A • ICES–003 Issue 4:2004 • EN 300 328 V1.7.1:2008 • EN 301 489–1V1.8.1:2008/–17 V2.11:2009 • EN 55022:2006+A1:2007/EN55024:1998+A1:2001+A2:2003 • EN 50371:2002 • EN 60950–1:2006/A11:2009/A1:2010 • Complies with IDA Standards (DB 102425) • India Equipment Type Approval (ETA) Certificate No: 1424/2011/WRLO • COFETEL Certificate No: RCPAGU111-1066, registered under Agilent Technologies Mexico S de RL de CV <p>"This telecommunication equipment conforms NTC technical requirement"</p>



Standard shipped items:

- Two 1.5 V AAA batteries
- Operating instructions



Agilent Email Updates

www.agilent.com/find/emailupdates

Get the latest information on the products and applications you select.



www.axistandard.org

AdvancedTCA® Extensions for Instrumentation and Test (AXIe) is an open standard that extends the AdvancedTCA for general purpose and semiconductor test. Agilent is a founding member of the AXIe consortium.



www.lxistandard.org

LAN eXtensions for Instruments puts the power of Ethernet and the Web inside your test systems. Agilent is a founding member of the LXI consortium.



www.pxisa.org

PCI eXtensions for Instrumentation (PXI) modular instrumentation delivers a rugged, PC-based high-performance measurement and automation system.

Agilent Channel Partners

www.agilent.com/find/channelpartners

Get the best of both worlds: Agilent's measurement expertise and product breadth, combined with channel partner convenience.

Agilent
Advantage
Services



Agilent Advantage Services is committed to your success throughout your equipment's lifetime. To keep you competitive, we continually invest in tools and processes that speed up calibration and repair and reduce your cost of ownership. You can also use Infoline Web Services to manage equipment and services more effectively. By sharing our measurement and service expertise, we help you create the products that change our world.

www.agilent.com/find/advantageservices



www.agilent.com

www.agilent.com/find/U1177A

For more information on Agilent Technologies' products, applications or services, please contact your local Agilent office. The complete list is available at:

www.agilent.com/find/contactus

Americas

Canada	(877) 894 4414
Brazil	(11) 4197 3600
Mexico	01800 5064 800
United States	(800) 829 4444

Asia Pacific

Australia	1 800 629 485
China	800 810 0189
Hong Kong	800 938 693
India	1 800 112 929
Japan	0120 (421) 345
Korea	080 769 0800
Malaysia	1 800 888 848
Singapore	1 800 375 8100
Taiwan	0800 047 866
Other AP Countries	(65) 375 8100

Europe & Middle East

Belgium	32 (0) 2 404 93 40
Denmark	45 45 80 12 15
Finland	358 (0) 10 855 2100
France	0825 010 700*
*0.125 €/minute	
Germany	49 (0) 7031 464 6333
Ireland	1890 924 204
Israel	972-3-9288-504/544
Italy	39 02 92 60 8484
Netherlands	31 (0) 20 547 2111
Spain	34 (91) 631 3300
Sweden	0200-88 22 55
United Kingdom	44 (0) 118 927 6201

For other unlisted countries:

www.agilent.com/find/contactus

Revised: January 6, 2012

Product specifications and descriptions in this document subject to change without notice.

© Agilent Technologies, Inc. 2012
Published in USA, February 2, 2012
5990-9531EN



Agilent Technologies



**Стандарт
Электрон
Связь**

Мы молодая и активно развивающаяся компания в области поставок электронных компонентов. Мы поставляем электронные компоненты отечественного и импортного производства напрямую от производителей и с крупнейших складов мира.

Благодаря сотрудничеству с мировыми поставщиками мы осуществляем комплексные и плановые поставки широчайшего спектра электронных компонентов.

Собственная эффективная логистика и склад в обеспечивает надежную поставку продукции в точно указанные сроки по всей России.

Мы осуществляем техническую поддержку нашим клиентам и предпродажную проверку качества продукции. На все поставляемые продукты мы предоставляем гарантию .

Осуществляем поставки продукции под контролем ВП МО РФ на предприятия военно-промышленного комплекса России , а также работаем в рамках 275 ФЗ с открытием отдельных счетов в уполномоченном банке. Система менеджмента качества компании соответствует требованиям ГОСТ ISO 9001.

Минимальные сроки поставки, гибкие цены, неограниченный ассортимент и индивидуальный подход к клиентам являются основой для выстраивания долгосрочного и эффективного сотрудничества с предприятиями радиоэлектронной промышленности, предприятиями ВПК и научно-исследовательскими институтами России.

С нами вы становитесь еще успешнее!

Наши контакты:

Телефон: +7 812 627 14 35

Электронная почта: sales@st-electron.ru

Адрес: 198099, Санкт-Петербург,
Промышленная ул, дом № 19, литера Н,
помещение 100-Н Офис 331