



NCP102 Demonstration Board Test Procedure

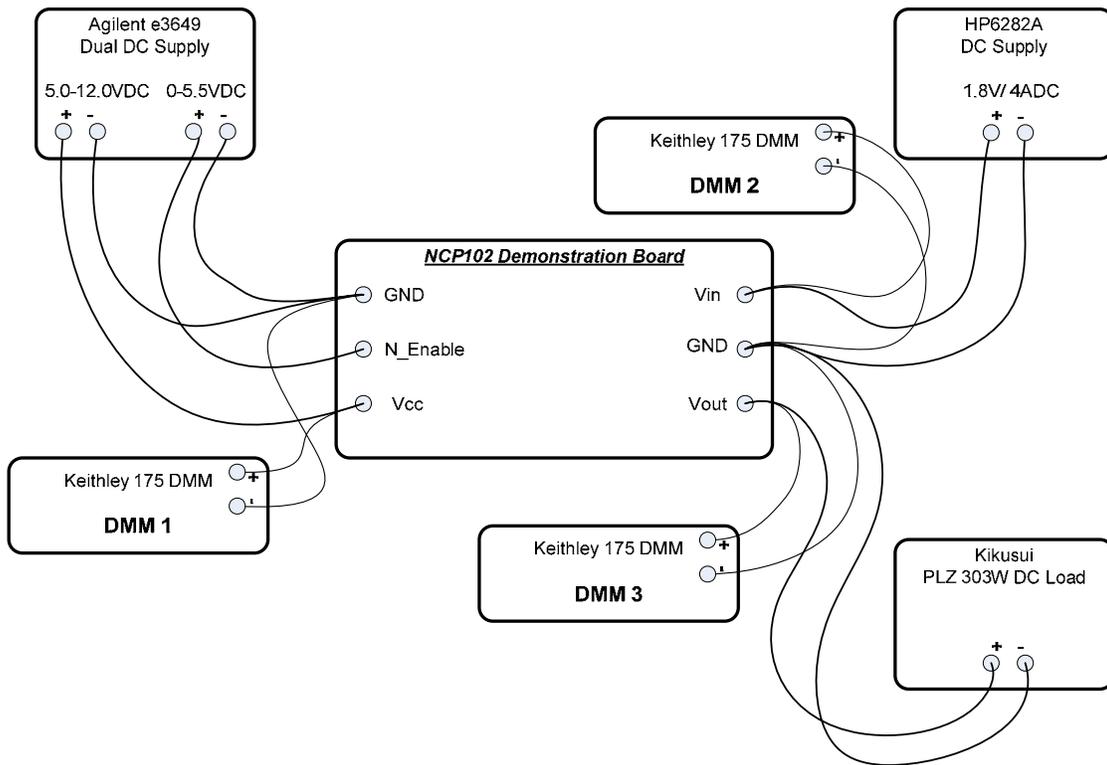


Figure 1 Test Setup

NCP102 Demonstration Board Test Procedure

Required Equipment:

1. **3 DC Power Supplies:**
 - a. “Vin supply” possessing a minimum voltage rating of 5 VDC and minimum current rating of 4 ADC; for example, HP 6282A.
 - b. “Vcc supply” possessing a minimum voltage rating of 15 VDC and minimum current rating of 1 ADC; for example, ½ Agilent e3649A dual supply.
 - c. “N_Enable supply” possessing a minimum voltage rating of 5.5 VDC and minimum current rating of 0.1 ADC; for example, ½ Agilent e3649A dual supply.
2. **3 Auto-ranging Digital Multimeters (DMMs):** each possessing a minimum voltage rating of 20 VDC and minimum current rating of 2ADC; for example, Keithley 175.
3. **1 Electronic Load:** possessing a current display and minimum current capability of 4 ADC; for example, Kikusui PLZ303W.

Test Procedure:

Establish Setup

1. Connect the NCP102 Demonstration Board as shown in Figure 1.
2. Adjust the N_Enable supply to 4.5VDC while observing the indicator on the supply.

Note: for measurement accuracy, the DMMs must be connected to the Demonstration Board terminals and not the DC supply or load terminals. This is particularly true for DMM 2 and DMM 3.

3. Connect DMM 1 to Vcc and configure as a voltmeter. Set DMM 1 for auto-range.
4. Connect DMM 2 to Vin and configure as a voltmeter. Set DMM 2 for auto-range.
5. Connect DMM 3 to Vout and configure as a voltmeter. Set DMM 3 for auto-range.

NCP102 Demonstration Board Test Procedure

6. Adjust the V_{cc} supply to 5.0VDC while observing DMM 1 (not the indicator on the DC supply).
7. Adjust the V_{in} supply to 1.800VDC while observing DMM 2 (not the indicator on the DC supply).
8. Disable the electronic load so that it is neither sinking nor sourcing current.

No-Load Regulation and Enable Function

1. Verify that V_{out} (DMM 3) equals zero VDC.
2. Temporarily disconnect the banana cable connected to “N_Enable”, or reduce the “N_Enable” supply to zero Volts.
3. Verify that V_{in} (DMM 2) equals 1.800VDC, +/- 2% (1.764VDC to 1.836VDC).
4. Readjust the V_{in} supply if necessary.
5. Verify that V_{out} (DMM 3) equals 1.200VDC, +/- 2% (1.176VDC to 1.224VDC).
6. Reconnect the banana cable to “N_Enable”, or adjust the “N_Enable” supply output to 4.5VDC.
7. If V_{cc} = 12.0VDC (DMM 1), go to *Full-Load Regulation and Enable Function*, below.
8. Adjust the V_{cc} supply to 12.0VDC, as indicated on DMM 1.
9. Repeat steps 1 through 7 of this section.

Full-Load Regulation and Enable Function

1. While observing the front panel indicator on the electronic load, adjust it to sink 3.5ADC from the demonstration board V_{out} terminal.
2. Enable the electronic load.
3. Verify that V_{out} (DMM 3) equals zero VDC.
4. Temporarily disconnect the banana cable connected to “N_Enable”, or reduce the “N_Enable” supply to zero Volts.
5. Verify that V_{in} (DMM 2) equals 1.800VDC, +/- 2% (1.764VDC to 1.836VDC).
6. Readjust the V_{in} supply if necessary.
7. Verify that V_{out} (DMM 3) equals 1.200VDC, +/- 2% (1.176VDC to 1.224VDC).
8. Reconnect the banana cable to “N_Enable”, or adjust the “N_Enable” supply output to 4.5VDC.

NCP102 Demonstration Board Test Procedure

9. If $V_{cc} = 5.0\text{VDC}$ (DMM 1), go to Step 12.
10. Adjust the V_{cc} supply to 5.0VDC , as indicated on DMM 1.
11. Repeat steps 1 through 9 of this section.
12. Verify that V_{out} (DMM 3) equals zero VDC .
13. Test complete.

| Revision History | | | |
|------------------|--------------|------------------|---------------|
| Revision | Release Date | Changes | Responsible |
| 1 | | Original Release | Mike Stimbert |
| | | | |



Стандарт Электрон Связь

Мы молодая и активно развивающаяся компания в области поставок электронных компонентов. Мы поставляем электронные компоненты отечественного и импортного производства напрямую от производителей и с крупнейших складов мира.

Благодаря сотрудничеству с мировыми поставщиками мы осуществляем комплексные и плановые поставки широчайшего спектра электронных компонентов.

Собственная эффективная логистика и склад в обеспечивает надежную поставку продукции в точно указанные сроки по всей России.

Мы осуществляем техническую поддержку нашим клиентам и предпродажную проверку качества продукции. На все поставляемые продукты мы предоставляем гарантию .

Осуществляем поставки продукции под контролем ВП МО РФ на предприятия военно-промышленного комплекса России , а также работаем в рамках 275 ФЗ с открытием отдельных счетов в уполномоченном банке. Система менеджмента качества компании соответствует требованиям ГОСТ ISO 9001.

Минимальные сроки поставки, гибкие цены, неограниченный ассортимент и индивидуальный подход к клиентам являются основой для выстраивания долгосрочного и эффективного сотрудничества с предприятиями радиоэлектронной промышленности, предприятиями ВПК и научно-исследовательскими институтами России.

С нами вы становитесь еще успешнее!

Наши контакты:

Телефон: +7 812 627 14 35

Электронная почта: sales@st-electron.ru

Адрес: 198099, Санкт-Петербург,
Промышленная ул, дом № 19, литера Н,
помещение 100-Н Офис 331